



**SCT RESERVE CONSULTANTS, INC.**

P.O. BOX 890129

TEMECULA, CA 92589-0129

PHONE (951) 296-3520 FAX (951) 296-5038 E-MAIL [mike.g@sctreserve.com](mailto:mike.g@sctreserve.com)

May 16, 2022

Job 2006-058-17 L3

Canyon Granada Homeowners Association  
c/o Maryellen Hill & Associates  
1111 Tahquitz Canyon Way, Suite 120  
Palm Springs, CA 92262  
Attn: Ms. Cindy Anderson

Subject: Year 2023 Level III Reserve Study

Dear Ms. Anderson,


SCT Reserve Consultants, Inc. is pleased to submit this **2023 Level III Reserve Study**.

There are two summary sections (starting at pages 4 and 5) that are required to be included in the Association's year-end mailing to the membership. They are the "**Reserve Summary**" and the "**Assessment and Reserve Funding Disclosure Summary**". They are to be mailed 30 to 90 days prior to the Association's year-end. These pages will satisfy the current California Civil Code requirements for homeowner disclosure.

The 'Year 2023 Reserve Budget' table of this report is AICPA approved; this may be included in the mailing but is generally not required. Check with legal counsel for greater clarification.

We appreciate the opportunity to provide our professional services. Should you have any need for clarification please contact me at (951) 296-3520.

Sincerely,



Michael C. Graves, R.S. #00039

*SCT Reserve Consultants, Inc. are affiliated with*





YEAR 2023  
LEVEL III  
RESERVE STUDY  
(FINANCIAL UPDATE REPORT)  
FOR  
CANYON GRANADA  
HOMEOWNERS ASSOCIATION  
VERSION 2

C/O MARYELLEN HILL & ASSOCIATES  
1111 TAHQUITZ CANYON WAY, SUITE 120  
PALM SPRINGS, CA 92262  
ATTN: MS. CINDY ANDERSON

SCT RESERVE CONSULTANTS, INC.  
P.O. Box 890129  
TEMECULA, CALIFORNIA 92589-0129  
COPYRIGHT © 2022 SCT, ALL RIGHTS RESERVED

*SCT Reserve Consultants, Inc. are affiliated with*



## Table of Contents

<i>Section</i>	<i>Page</i>
<b>Reserve Summary .....</b>	<b>4</b>
<b>Assessment and Reserve Funding Disclosure Summary.....</b>	<b>5</b>
<b>Summary.....</b>	<b>7</b>
<b>Year 2023 Reserve Budget .....</b>	<b>9</b>
<b>Component Identification Report .....</b>	<b>10</b>
<b>Component Replacement Cost Chart .....</b>	<b>14</b>
<b>Cash Flow and Percent Funded Projections .....</b>	<b>15</b>
<b>Cash Flow and Percent Funded Chart .....</b>	<b>16</b>
<b>10 Year Expenditure and Cash Flow by Category .....</b>	<b>17</b>
<b>Professional Credentials.....</b>	<b>21</b>
<b>Disclosure Statements.....</b>	<b>22</b>
<b>Definition of Terms .....</b>	<b>23</b>
<b>2020 California Civil Code (Selected Sections).....</b>	<b>25</b>



# Reserve Summary

(As required by California Civil Code Section 5565)

## CANYON GRANADA HOMEOWNERS ASSOCIATION

SCT Reserve Consultants, Inc. is pleased to provide this Level III Reserve Study (Financial Update Report). In order to comply with the California Civil Code, specifically the Davis-Stirling Common Interest Development Act, Section 5565, we are providing the following information to the Homeowners within CANYON GRANADA HOMEOWNERS ASSOCIATION.

The following study has been prepared with several assumed factors taken into account: a 3.00% inflation rate; a 1.00% return on investment (interest earned); taxes on interest earned is paid for through the operating fund; an estimated remaining life of each reserve component; and an estimated current replacement cost of each reserve component.

As of June 30, 2022, the estimated ending reserve fund balance is \$323,500 and the estimated current replacement cost is \$1,399,887 for the portfolio of reserve components. The projected future replacement cost of the portfolio is \$2,207,532, calculated at an annually compounded inflation rate of 3.00%. The Association's level of funding which is based upon the estimated ending reserve fund balance divided by the reserve components' fully funded amount is 39.84%. This is referred to as Percent Funded. The Association would be 100.00% funded if there were \$811,933.88 in the reserve fund.

The current deficiency (or surplus if the number is in parenthesis) in reserve funding expressed on a per unit basis is \$8,140.56. This is calculated by subtracting the ending balance (\$323,500) from the 100% funded figure (\$811,933.88), then divided by the number of ownership interests (60). There is currently no requirement to be fully funded.

Our original analysis of the cash flow for this association indicated future inadequate funding if there were no annual increases to the Reserves. It is our understanding the Board of Directors will allocate a monthly amount of \$5,900.00 starting in 2023 (\$98.33 per unit per month for each of the 60 ownership interests) towards the reserve fund. To offset the over/under cash results of the report, we recommend and have included changes of 15.00% starting in 2024 for 4 years, 4.50% starting in 2028 for 1 year and 3.00% starting in 2029 for 24 years. The change is scheduled to take effect in the year 2024. This report includes \$14,000 for Reserve Reimbursement in 2023 for 1 year. The Board of Directors may change the amount; however, it will impact the level of funding on reserves. These numbers, by themselves, are not a clear indicator of financial strength and could indicate underfunding, overfunding, or adequate funding.

The following table represents additionally required information pursuant to the Davis-Stirling Common Interest Development Act, Section 5565.

Fiscal Year: July 1, 2022 through June 30, 2023

Category	Range of Full Useful Life	Range of Remaining Useful Life	Current Replacement Cost	Fund Balance on Jul 01, 2022	Reserve Allocation	Reserve Reimbursement	Interest
Access System	8 to 16	1 to 3	\$54,000	\$9,039	\$1,978	\$391	\$36
Asphalt & Concrete	3 to 30	0 to 15	\$157,422	\$40,821	\$8,934	\$1,767	\$162
Buildings	1 to 45	0 to 31	\$636,971	\$69,356	\$15,179	\$3,002	\$276
Electrical & Lights	1 to 40	0 to 15	\$15,790	\$3,674	\$804	\$159	\$15
Fence & Gates	32 to 32	15 to 16	\$100,380	\$10,422	\$2,281	\$451	\$41
Irrigation	12 to 12	1 to 1	\$6,400	\$1,203	\$263	\$52	\$5
Landscape	15 to 30	0 to 16	\$52,000	\$4,887	\$1,070	\$212	\$19
Mailboxes	27 to 27	22 to 22	\$6,800	\$284	\$62	\$12	\$1
Paint	4 to 12	0 to 0	\$165,070	\$134,052	\$29,338	\$5,801	\$533
Plumbing, Major Exterior	2 to 2	0 to 0	\$4,750	\$4,198	\$919	\$182	\$17
Pools & Spas	5 to 24	0 to 18	\$189,000	\$36,371	\$7,960	\$1,574	\$145
Tennis Courts	8 to 8	0 to 0	\$11,304	\$9,194	\$2,012	\$398	\$37
<b>Totals:</b>			<b>\$1,399,887</b>	<b>\$323,500</b>	<b>\$70,800</b>	<b>\$14,000</b>	<b>\$1,287</b>

The complete reserve study is available by request from the Association.



# Assessment and Reserve Funding Disclosure Summary

## For the Fiscal Year Ending June 30, 2023

(As illustrated by California Civil Code Section 5570(a))

(1) The regular assessment per ownership interest is **\$520.00** per month, of which approximately **\$98.33** is allocated to reserves, monthly.

Note: If assessments vary by the size or type of ownership interest, the assessment applicable to this ownership interest may be found on the following page of the attached summary. **NOT APPLICABLE**

(2) Additional regular or special assessments that have already been scheduled to be imposed or charged, regardless of the purpose, if they have been approved by the board and/or members: **SEE ANSWER BELOW TO QUESTION #4 WHICH SUGGESTS THERE WILL BE INCREASES IN REGULAR ASSESSMENTS FOR RESERVE FUNDING.**

Date assessment will be due:	Amount per ownership interest per month or year:	Purpose of the assessment:

Note: If assessments vary by the size or type of ownership interest, the assessment applicable to this ownership interest may be found on the following page of the attached summary. **NOT APPLICABLE**

(3) Based upon the most recent reserve study and other information available to the board of directors, will currently projected reserve account balances be sufficient at the end of each year to meet the association's obligation for repair and/or replacement of major components during the next 30 years?

Yes   X        No   X  

**Yes**, if the Association follows the recommended future reserve contribution increases as outlined in the reserve study and disclosed in the table of question (4) with consideration to the note below\*.

**No**, if the Association does not follow the recommended future reserve contribution increases as outlined in the reserve study and disclosed in the table of question (4) with consideration to the note below\*.

*\*Note: The information contained within the reserve study includes estimates of replacement value and life expectancies of the components and includes assumptions regarding future events based on information provided by and supplied to the Association's Board of Directors and/or management. Some assumptions inevitably will not materialize and unanticipated events and circumstances may occur subsequent to the data of this disclosure summary. Therefore, the actual replacement cost and remaining life may vary from the reserve study and the variation may be significant. Additionally, inflation and other economic events may impact the reserve study, particularly over a thirty (30) year period of time which could impact the accuracy of the reserve study and the funds available to meet the association's obligation for repair and/or replacement of major components during the next thirty (30) years. Furthermore, the occurrence of vandalism, severe weather conditions, earthquakes, floods or other acts of God cannot be accounted for and are excluded when assessing life expectancy of the components. The reserve study only includes items that the Association has a clear and express responsibility to maintain, pursuant to the Association's CC&Rs.*

(4) If the answer to (3) is No, what additional assessments or other contributions to reserves would be necessary to ensure that sufficient reserve funds will be available each year during the next 30 years that have not yet been approved by the Board or the members?

Approximate date assessment(s) will be due:	Amount per ownership interest per month:
<b>15.00% starting in 2024 for 4 years, 4.50% starting in 2028 for 1 year and 3.00% starting in 2029 for 24 years</b>	<b>(Current amount) X (the increases)</b>

(5) All major components are included in the reserve study and are included in its calculations.

(6) Based on the method of calculation in paragraph (4) of subdivision (b) of Section 5550, the estimated amount required in the reserve fund at the end of the current fiscal year is **\$650,474.39**, as of **June 30, 2023**, based in whole or in part on the last reserve study or update prepared by **SCT RESERVE CONSULTANTS, INC.** The projected reserve fund cash balance at the end of the current fiscal year is **\$154,779.73**, resulting in reserves being **23.79%** percent funded at this date. If an alternate, but generally accepted, method of calculation is also used, the required amount is **\$254,807**. (See explanation below).

**Explanation:** *Cash Flow Methodology - a method of developing a reserve funding plan where contributions to the reserve fund are designed to offset the variable annual expenditures from the reserve fund. Different reserve funding plans are tested against the anticipated schedule of reserve expenses until the desired funding goal is achieved.*



# Assessment and Reserve Funding Disclosure Summary

## For the Fiscal Year Ending June 30, 2023

(continued)

7) **See below: 30-Year Reserve Funding Plan Table...** Based on the method of calculation in paragraph (4) of subdivision (b) of Section 5550 of the Civil Code, the estimated amount required in the reserve fund at the end of each of the next five budget years is \$(see “100% Funded” column below), and the projected reserve fund cash balance in each of those years, taking into account only assessments already approved and other known revenues, is \$(see “Cash Flow Balance with Funding Plan” column below), leaving the reserve at (see “Percent Funded” column below) percent funding. If the reserve funding plan approved by the association is implemented, the projected reserve fund cash balance in each of those years will be \$(see “Cash Flow Balance with Funding Plan” column below), leaving the reserve at (see “Percent Funded” column below) percent funding. Note: The financial representations set forth in this summary are based on the best estimates of the preparer at that time. The estimates are subject to change. At the time this summary was prepared, the assumed long-term before-tax interest rate earned on reserve funds was **1.00%** per year, and the assumed long-term inflation rate to be applied to major component repair and replacement costs was **3.00%** per year.

**30-Year Reserve Funding Plan Table**

Year	End of Year			Revenue			Expenditures Components, Taxes, Deferred Exp
	100% Funded	Cash Flow	Percent Funded	Contribution, Interest	Contribution Unit/Month	Funding Plan	
2022	\$811,934	\$323,500	39.84%				
2023	\$650,474	\$154,780	23.79%	\$86,087	\$98.33	0.00%	\$254,807
2024	\$670,411	\$161,558	24.10%	\$82,653	\$113.08	15.00%	\$75,875
2025	\$725,364	\$215,579	29.72%	\$95,328	\$130.05	15.00%	\$41,306
2026	\$771,907	\$273,195	35.39%	\$109,881	\$149.55	15.00%	\$52,265
2027	\$829,690	\$357,965	43.14%	\$126,791	\$171.99	15.00%	\$42,021
2028	\$841,931	\$392,086	46.57%	\$132,698	\$179.72	4.50%	\$98,577
2029	\$851,758	\$423,220	49.69%	\$136,874	\$185.12	3.00%	\$105,739
2030	\$939,235	\$550,462	58.61%	\$142,080	\$190.67	3.00%	\$14,838
2031	\$985,588	\$633,272	64.25%	\$147,022	\$196.39	3.00%	\$64,211
2032	\$923,060	\$566,705	61.39%	\$150,644	\$202.28	3.00%	\$217,212
2033	\$887,566	\$541,272	60.98%	\$154,724	\$208.35	3.00%	\$180,156
2034	\$782,309	\$401,550	51.33%	\$157,861	\$214.60	3.00%	\$297,583
2035	\$684,595	\$277,885	40.59%	\$161,238	\$221.04	3.00%	\$284,903
2036	\$774,159	\$402,179	51.95%	\$167,124	\$227.67	3.00%	\$42,830
2037	\$882,438	\$560,612	63.53%	\$173,581	\$234.50	3.00%	\$15,149
2038	\$845,891	\$517,703	61.20%	\$178,280	\$241.54	3.00%	\$221,189
2039	\$864,976	\$557,145	64.41%	\$183,832	\$248.78	3.00%	\$144,390
2040	\$971,572	\$716,265	73.72%	\$190,714	\$256.24	3.00%	\$31,594
2041	\$966,693	\$730,574	75.57%	\$196,427	\$263.93	3.00%	\$182,118
2042	\$939,118	\$710,926	75.70%	\$201,920	\$271.85	3.00%	\$221,568
2043	\$950,846	\$766,045	80.56%	\$208,283	\$280.01	3.00%	\$153,164
2044	\$1,028,351	\$883,284	85.89%	\$215,444	\$288.41	3.00%	\$98,205
2045	\$1,133,964	\$1,050,594	92.65%	\$223,289	\$297.06	3.00%	\$55,979
2046	\$1,273,371	\$1,272,060	99.90%	\$231,857	\$305.97	3.00%	\$10,391
2047	\$1,122,561	\$1,106,744	98.59%	\$236,952	\$315.15	3.00%	\$402,268
2048	\$972,845	\$795,024	81.72%	\$240,687	\$324.60	3.00%	\$552,408
2049	\$1,041,038	\$887,010	85.20%	\$248,414	\$334.34	3.00%	\$156,428
2050	\$1,152,811	\$1,067,055	92.56%	\$257,358	\$344.37	3.00%	\$77,312
2051	\$1,239,536	\$1,221,635	98.56%	\$266,311	\$354.70	3.00%	\$111,731
2052	\$1,222,979	\$1,228,665	100.46%	\$274,069	\$365.34	3.00%	\$267,039
<b>30-Year Sum:</b>				<b>\$5,378,422</b>			<b>\$4,473,257</b>



## Summary

In accordance with our proposal, 2006-058, SCT Reserve Consultants, Inc. is pleased to provide this ***Level III Reserve Study Financial Update Report for CANYON GRANADA HOMEOWNERS ASSOCIATION***. Our study was performed in accordance with the Davis-Stirling Common Interest Development Act, specifically §5550, of the California Civil Code. This report included a site inspection on February 22, 2021. This *condominium* common interest development (CID) is located at 255 Avenida Granada, Palm Springs, California. We are using an inception date for the components of July 1, 1984. ***This study is for July 1, 2022 through June 30, 2023, the Association's fiscal year.***

In general, reserve funds are funds set aside from collected association fees paid by owners of a common interest development. These funds earn interest and are disbursed when deemed necessary by the Board of Directors. The purpose of a reserve study is to determine how much money should exist in a reserve fund at a given point in time or to project required future contributions and expenditure amounts so that sufficient reserve funds are available when needed. Our reserve study is generated using proprietary SCT software and a combination of local industry standards and national average replacement costs.

The SCT software utilizes the weighted average life (WAL) of the reserve components. The future cost method for the WAL is calculated by using the current replacement cost of each component, as of the analysis date, and the number of years until each reserve component is scheduled to be replaced. This determines the monthly reserve contributions needed and calculates the future reserve balances.

A 30-year “Cash Flow and Percent Funded Projection” analysis and “Graph” are produced to verify and define the relationship of the Cash Flow (annual beginning balance) with respect to the 100% funded amount. Ideally, the Cash Flow line of the graph should run parallel to and below the “Percent Funded” line of the graph, see funding goals.

The following study has been prepared with several assumed factors taken into account: 3.00% inflation rate; a 1.00% return on investment (interest earned); taxes on interest earned is paid for through the operating fund; an estimated remaining life of each reserve component; and an estimated current replacement cost of each reserve component.

Typically, any component that has a life cycle (full life) of less than two years should be budgeted and paid for through normal operating or property maintenance funds and is not included as part of this study.

**The current deficiency (or surplus if the number is in parenthesis) in reserve funding expressed on a per unit basis is \$8,140.56.** This is calculated by subtracting the ending balance (\$323,500) from the 100% funded figure (\$811,933.88), then divided by the number of ownership interests (60). There is currently no requirement to be fully funded.




## Summary (continued)

As of July 1, 2022, the estimated reserve fund balance is \$323,500 and the estimated current replacement cost is \$1,399,887 of the portfolio of reserve components. The projected future replacement cost of the portfolio is \$2,207,532, calculated at an annually compounded inflation rate of 3.00%. The Davis-Stirling Common Interest Development Act requires the disclosure of the *current reserve fund balance divided by the current replacement cost* (this is not *Percent Funded*). Currently, *this factor for CANYON GRANADA HOMEOWNERS ASSOCIATION is 23.11%*.

The Association's level of funding for the fiscal year (July 1, 2022 through June 30, 2023) which is based upon the final estimated reserve fund balance divided by the reserve components' fully funded amount is **23.79%, and is referred to as *Percent Funded***. The Association would be 100.00% funded if there were \$650,474.39 in the reserve fund.

Our original analysis of the cash flow for this association indicated future inadequate funding (see the graph, the "square box and/or pink line"). This line represents the cash flow if there were no annual increases to the Reserves. ***It is our understanding the Board of Directors will allocate a monthly amount of \$5,900.00 starting in 2023 (\$98.33 per unit per month for each of the 60 ownership interests) towards the reserve fund. To offset the over/under cash results of the report, we recommend and have included changes of 15.00% starting in 2024 for 4 years, 4.50% starting in 2028 for 1 year and 3.00% starting in 2029 for 24 years. The change is scheduled to take effect in the year 2024. This report includes \$14,000 for Reserve Reimbursement in 2023 for 1 year.*** The Board of Directors may raise or lower this amount, however, it will impact the level of funding on reserves. These numbers, by themselves, are not a clear indicator of financial strength and could indicate underfunding, overfunding, or adequate funding.

Sincerely,

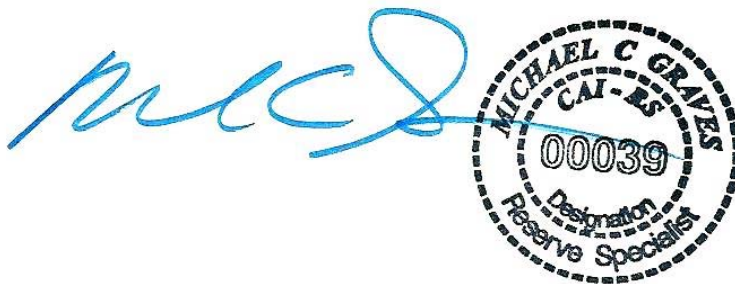

The image shows a handwritten signature in blue ink that reads "mcd". To the right of the signature is a circular professional seal. The seal has a dashed outer border and contains the following text: "MICHAEL C. GRAVES" at the top, "CAI-BS" in the middle, "00039" in the center, and "Designation Reserve Specialist" at the bottom.

Michael C. Graves, R.S. #00039  
SCT Reserve Consultants, Inc.



## Year 2023 Reserve Budget (AICPA Approved)

Category	Beginning Balance Jul 01, 2022	Annual Reserve Allocation	Monthly Reserve Allocation	Reserve Reimbursement	Annual Interest Allocation	Expenditure	Ending Balance Jun 30, 2023	100% Funded Jun 30, 2023	Percent Funded Jun 30, 2023
Access System	\$9,039.29	\$1,978.31	\$164.86	\$391.19	\$35.96	\$0.00	\$11,444.75	\$48,097.50	23.79%
Asphalt & Concrete	\$40,820.57	\$8,933.84	\$744.49	\$1,766.58	\$162.40	\$29,514.00	\$22,169.39	\$93,168.67	23.79%
Buildings	\$69,356.15	\$15,179.03	\$1,264.92	\$3,001.50	\$275.93	\$23,069.10	\$64,743.52	\$272,089.88	23.79%
Electrical & Lights	\$3,673.64	\$804.00	\$67.00	\$158.98	\$14.62	\$2,200.00	\$2,451.23	\$10,301.50	23.79%
Fence & Gates	\$10,421.69	\$2,280.85	\$190.07	\$451.02	\$41.46	\$0.00	\$13,195.02	\$55,453.13	23.79%
Irrigation	\$1,202.80	\$263.24	\$21.94	\$52.05	\$4.79	\$0.00	\$1,522.87	\$6,400.00	23.79%
Landscape	\$4,887.33	\$1,069.62	\$89.14	\$211.51	\$19.44	\$2,000.00	\$4,187.90	\$17,600.00	23.79%
Mailboxes	\$283.99	\$62.15	\$5.18	\$12.29	\$1.13	\$0.00	\$359.57	\$1,511.11	23.79%
Paint	\$134,051.63	\$29,338.04	\$2,444.84	\$5,801.31	\$533.32	\$165,070.20	\$4,654.09	\$19,559.18	23.79%
Plumbing, Major Exterior	\$4,197.99	\$918.76	\$76.56	\$181.68	\$16.70	\$4,750.00	\$565.13	\$2,375.00	23.79%
Pools & Spas	\$36,371.24	\$7,960.07	\$663.34	\$1,574.03	\$144.70	\$16,900.00	\$29,150.04	\$122,505.42	23.79%
Tennis Courts	\$9,193.68	\$2,012.09	\$167.67	\$397.87	\$36.58	\$11,304.00	\$336.22	\$1,413.00	23.79%
<b>Totals:</b>	<b>\$323,500.00</b>	<b>\$70,800.00</b>	<b>\$5,900.00</b>	<b>\$14,000.00</b>	<b>\$1,287.03</b>	<b>\$254,807.30</b>	<b>\$154,779.73</b>	<b>\$650,474.39</b>	<b>23.79%</b>



## Component Identification Report

Identified Major Components	Quantity	Measurement Basis	FUL	RUL	Basis Cost	Current Replacement Cost	Future Replacement Cost (3% inflation)	Straight Line Allocation	100% Funded Jul, 2022
<b>Access System</b>									
Gate operators	2	Each	10	1	\$4,200.00	\$8,400.00	\$8,652.00	\$840.00	\$7,560.00
Gate operators	2	Each	10	2	\$4,200.00	\$8,400.00	\$8,912.00	\$840.00	\$6,720.00
Loop systems	2	Each	16	1	\$3,500.00	\$7,000.00	\$7,210.00	\$437.50	\$6,562.50
Loop systems	2	Each	16	2	\$3,500.00	\$7,000.00	\$7,426.00	\$437.50	\$6,125.00
Phone directory	1	Each	12	1	\$4,700.00	\$4,700.00	\$4,841.00	\$391.67	\$4,308.33
Surveillance system	1	Lump Sum	8	3	\$18,500.00	\$18,500.00	\$20,215.00	\$2,312.50	\$11,562.50
<i>Subtotal:</i>						\$54,000.00	\$57,256.00	\$5,259.17	\$42,838.33
<b>Asphalt &amp; Concrete</b>									
Concrete, curb/gutter repair	1	Lump Sum	4	0	\$2,500.00	\$2,500.00	\$2,814.00	\$625.00	\$2,500.00
Concrete, stamped, color seal	2,838	Square Feet	5	0	\$3.00	\$8,514.00	\$9,870.00	\$1,702.80	\$8,514.00
Concrete, stamped, Entries	2,838	Square Feet	30	9	\$16.00	\$45,408.00	\$59,247.00	\$1,513.60	\$31,785.60
Concrete, walkways	1	Lump Sum	3	0	\$5,000.00	\$5,000.00	\$5,464.00	\$1,666.67	\$5,000.00
Repair/overlay/R&R	2,500	Square Feet	28	0	\$3.00	\$7,500.00	\$17,159.00	\$267.86	\$7,500.00
Repair/overlay/R&R	2,500	Square Feet	28	3	\$3.00	\$7,500.00	\$8,195.00	\$267.86	\$6,696.43
Repair/overlay/R&R	22,500	Square Feet	28	11	\$3.00	\$67,500.00	\$93,436.00	\$2,410.71	\$40,982.14
Repair/overlay/R&R	2,500	Square Feet	28	15	\$3.00	\$7,500.00	\$11,685.00	\$267.86	\$3,482.14
Seal/stripe/repair/crack fill	30,000	Square Feet	4	0	\$0.20	\$6,000.00	\$6,753.00	\$1,500.00	\$6,000.00
<i>Subtotal:</i>						\$157,422.00	\$214,623.00	\$10,222.36	\$112,460.31
<b>Buildings</b>									
Awnings, canvas (allowance)	1	Each	1	0	\$1,065.00	\$1,065.00	\$1,097.00	\$1,065.00	\$1,065.00
Landings/stairs, coating	6,378	Square Feet	5	0	\$3.45	\$22,004.10	\$25,509.00	\$4,400.82	\$22,004.10
Landings/stairs, inspection (SB361/ \$5551)	1	Lump Sum	9	0	\$0.00	\$0.00	\$0.00	\$0.00	\$0.00
Roofs, carports, tile/underlayment	90	Square	35	10	\$600.00	\$54,000.00	\$72,571.00	\$1,542.86	\$38,571.43
Roofs, carports, tile/underlayment	90	Square	35	11	\$600.00	\$54,000.00	\$74,749.00	\$1,542.86	\$37,028.57
Roofs, flat, elastomeric coating	391	Square	10	9	\$255.76	\$100,002.16	\$130,480.00	\$10,000.22	\$10,000.22
Roofs, flat, polyurethane foam	391	Square	40	25	\$450.00	\$175,950.00	\$368,400.00	\$4,398.75	\$65,981.25
Roofs, tile/underlayment	164	Square	45	30	\$600.00	\$98,400.00	\$238,843.00	\$2,186.67	\$32,800.00
Roofs, tile/underlayment	164	Square	45	31	\$600.00	\$98,400.00	\$246,008.00	\$2,186.67	\$30,613.33



## Component Identification Report

(continued)

Identified Major Components	Quantity	Measurement Basis	FUL	RUL	Basis Cost	Current Replacement Cost	Future Replacement Cost (3% inflation)	Straight Line Allocation	100% Funded Jul, 2022
Windows, replace (on decks)	15	Each	40	1	\$425.00	\$6,375.00	\$6,566.00	\$159.38	\$6,215.63
Windows, replace (on decks)	15	Each	40	3	\$425.00	\$6,375.00	\$6,966.00	\$159.38	\$5,896.88
Windows, replace (on decks)	16	Each	40	5	\$425.00	\$6,800.00	\$7,883.00	\$170.00	\$5,950.00
Windows, replace (on decks)	16	Each	40	7	\$425.00	\$6,800.00	\$8,363.00	\$170.00	\$5,610.00
Windows, replace (on decks)	16	Each	40	9	\$425.00	\$6,800.00	\$8,872.00	\$170.00	\$5,270.00
<i>Subtotal:</i>						\$636,971.26	\$1,196,307.00	\$28,152.61	\$267,006.40
<b>Electrical &amp; Lights</b>									
Fixtures, globe/pole 6'	9	Each	27	12	\$360.00	\$3,240.00	\$4,619.00	\$120.00	\$1,800.00
Fixtures, wall mount	40	Each	25	13	\$105.00	\$4,200.00	\$6,168.00	\$168.00	\$2,016.00
Fixtures/poles, Tennis Courts	6	Each	40	15	\$1,025.00	\$6,150.00	\$9,581.00	\$153.75	\$3,843.75
Landscape fixtures, repairs/ replacement	1	Lump Sum	1	0	\$2,200.00	\$2,200.00	\$2,266.00	\$2,200.00	\$2,200.00
<i>Subtotal:</i>						\$15,790.00	\$22,634.00	\$2,641.75	\$9,859.75
<b>Fence &amp; Gates</b>									
Fence, metal, perimeter	1,620	Linear Feet	32	15	\$42.00	\$68,040.00	\$106,004.00	\$2,126.25	\$36,146.25
Fence, metal, pool areas	370	Linear Feet	32	16	\$42.00	\$15,540.00	\$24,937.00	\$485.62	\$7,770.00
Gates, metal, vehicle	4	Each	32	16	\$4,200.00	\$16,800.00	\$26,959.00	\$525.00	\$8,400.00
<i>Subtotal:</i>						\$100,380.00	\$157,900.00	\$3,136.87	\$52,316.25
<b>Irrigation</b>									
Controllers	4	Each	12	1	\$1,600.00	\$6,400.00	\$6,592.00	\$533.33	\$5,866.67
<i>Subtotal:</i>						\$6,400.00	\$6,592.00	\$533.33	\$5,866.67
<b>Landscape</b>									
Fountain, replace	1	Each	20	0	\$2,000.00	\$2,000.00	\$3,612.00	\$100.00	\$2,000.00
Landscape, refurbish	1	Lump Sum	15	11	\$45,000.00	\$45,000.00	\$62,291.00	\$3,000.00	\$12,000.00
Storage shed	1	Each	30	16	\$5,000.00	\$5,000.00	\$8,024.00	\$166.67	\$2,333.33
<i>Subtotal:</i>						\$52,000.00	\$73,927.00	\$3,266.67	\$16,333.33
<b>Mailboxes</b>									
Mailboxes	4	Each	27	22	\$1,700.00	\$6,800.00	\$13,030.00	\$251.85	\$1,259.26
<i>Subtotal:</i>						\$6,800.00	\$13,030.00	\$251.85	\$1,259.26
<b>Paint</b>									



## Component Identification Report

(continued)

Identified Major Components	Quantity	Measurement Basis	FUL	RUL	Basis Cost	Current Replacement Cost	Future Replacement Cost (3% inflation)	Straight Line Allocation	100% Funded Jul, 2022
Buildings, doors (sand/stain)	60	Each	6	0	\$600.00	\$36,000.00	\$42,986.00	\$6,000.00	\$36,000.00
Buildings, stucco (~72500 SF)	60	Per Unit	12	0	\$1,100.00	\$66,000.00	\$94,100.00	\$5,500.00	\$66,000.00
Carports, stucco	27,312	Square Feet	12	0	\$1.10	\$30,043.20	\$42,834.00	\$2,503.60	\$30,043.20
Fence, chainlink, Tennis Courts	1	Lump Sum	12	0	\$7,000.00	\$7,000.00	\$9,980.00	\$583.33	\$7,000.00
Fence, metal, perimeter	1,620	Linear Feet	4	0	\$8.00	\$12,960.00	\$14,587.00	\$3,240.00	\$12,960.00
Fence, metal, Pool Areas	370	Linear Feet	4	0	\$8.00	\$2,960.00	\$3,332.00	\$740.00	\$2,960.00
Mailboxes & trash gates	1	Lump Sum	4	0	\$900.00	\$900.00	\$1,013.00	\$225.00	\$900.00
Walls, stucco	8,370	Square Feet	12	0	\$1.10	\$9,207.00	\$13,127.00	\$767.25	\$9,207.00
<i>Subtotal:</i>						\$165,070.20	\$221,959.00	\$19,559.18	\$165,070.20
<b>Plumbing, Major Exterior</b>									
Sewer pipe repairs	1	Lump Sum	2	0	\$4,750.00	\$4,750.00	\$5,039.00	\$2,375.00	\$4,750.00
<i>Subtotal:</i>						\$4,750.00	\$5,039.00	\$2,375.00	\$4,750.00
<b>Pools &amp; Spas</b>									
East, deck coating	3,260	Square Feet	5	0	\$2.50	\$8,150.00	\$9,448.00	\$1,630.00	\$8,150.00
East, deck resurface	3,260	Square Feet	20	10	\$5.00	\$16,300.00	\$21,906.00	\$815.00	\$8,150.00
East, deck skimmers	4	Each	24	2	\$1,600.00	\$6,400.00	\$6,790.00	\$266.67	\$5,866.67
East, furniture	1	Lump Sum	8	1	\$6,000.00	\$6,000.00	\$6,180.00	\$750.00	\$5,250.00
East, pool filter	1	Each	12	1	\$1,300.00	\$1,300.00	\$1,339.00	\$108.33	\$1,191.67
East, pool filter	1	Each	12	6	\$1,300.00	\$1,300.00	\$1,552.00	\$108.33	\$650.00
East, pool heater	1	Each	10	8	\$4,000.00	\$4,000.00	\$5,067.00	\$400.00	\$800.00
East, pool pumpsets, VS	2	Each	8	5	\$2,000.00	\$4,000.00	\$4,637.00	\$500.00	\$1,500.00
East, pool resurface	185	Linear Feet	12	6	\$85.00	\$15,725.00	\$18,776.00	\$1,310.42	\$7,862.50
East, pool solar panels	305	Square Feet	20	1	\$25.00	\$7,625.00	\$7,854.00	\$381.25	\$7,243.75
East, pool solar panels	195	Square Feet	20	11	\$25.00	\$4,875.00	\$6,748.00	\$243.75	\$2,193.75
East, pool tile	185	Linear Feet	24	18	\$25.00	\$4,625.00	\$7,874.00	\$192.71	\$1,156.25
East, spa filter	1	Each	12	1	\$1,300.00	\$1,300.00	\$1,339.00	\$108.33	\$1,191.67
East, spa heater	1	Each	10	1	\$4,000.00	\$4,000.00	\$4,120.00	\$400.00	\$3,600.00
East, spa pumpset, circulation, VS	1	Each	8	6	\$2,000.00	\$2,000.00	\$2,388.00	\$250.00	\$500.00
East, spa pumpsets, jet	2	Each	12	8	\$1,025.00	\$2,050.00	\$2,597.00	\$170.83	\$683.33
East, spa resurface	32	Linear Feet	8	2	\$135.00	\$4,320.00	\$4,583.00	\$540.00	\$3,240.00




## Component Identification Report

(continued)

Identified Major Components	Quantity	Measurement Basis	FUL	RUL	Basis Cost	Current Replacement Cost	Future Replacement Cost (3% inflation)	Straight Line Allocation	100% Funded Jul, 2022
East, spa tile	32	Linear Feet	16	1	\$25.00	\$800.00	\$824.00	\$50.00	\$750.00
West, deck coating	3,500	Square Feet	5	0	\$2.50	\$8,750.00	\$10,144.00	\$1,750.00	\$8,750.00
West, deck resurface	3,500	Square Feet	20	5	\$5.00	\$17,500.00	\$20,287.00	\$875.00	\$13,125.00
West, deck skimmers	3	Each	24	2	\$1,600.00	\$4,800.00	\$5,092.00	\$200.00	\$4,400.00
West, deck skimmers	1	Each	24	12	\$1,600.00	\$1,600.00	\$2,281.00	\$66.67	\$800.00
West, furniture	1	Lump Sum	6	4	\$4,000.00	\$4,000.00	\$4,502.00	\$666.67	\$1,333.33
West, pool filters	2	Each	12	3	\$1,300.00	\$2,600.00	\$2,841.00	\$216.67	\$1,950.00
West, pool heater	1	Each	10	1	\$4,000.00	\$4,000.00	\$4,120.00	\$400.00	\$3,600.00
West, pool pumpsets, VS	2	Each	8	5	\$2,000.00	\$4,000.00	\$4,637.00	\$500.00	\$1,500.00
West, pool resurface	179	Linear Feet	12	6	\$85.00	\$15,215.00	\$18,168.00	\$1,267.92	\$7,607.50
West, pool solar panels	500	Square Feet	20	1	\$25.00	\$12,500.00	\$12,875.00	\$625.00	\$11,875.00
West, pool tile	179	Linear Feet	24	18	\$25.00	\$4,475.00	\$7,618.00	\$186.46	\$1,118.75
West, spa filter	1	Each	12	6	\$1,300.00	\$1,300.00	\$1,552.00	\$108.33	\$650.00
West, spa heater	1	Each	10	6	\$4,000.00	\$4,000.00	\$4,776.00	\$400.00	\$1,600.00
West, spa pumpset, circulation, VS	1	Each	8	7	\$2,000.00	\$2,000.00	\$2,460.00	\$250.00	\$250.00
West, spa pumpsets, jet	2	Each	12	5	\$1,025.00	\$2,050.00	\$2,377.00	\$170.83	\$1,195.83
West, spa resurface	34	Linear Feet	8	3	\$135.00	\$4,590.00	\$5,016.00	\$573.75	\$2,868.75
West, spa tile	34	Linear Feet	16	11	\$25.00	\$850.00	\$1,177.00	\$53.12	\$265.63
<i>Subtotal:</i>						\$189,000.00	\$223,945.00	\$16,536.04	\$122,869.38
<b>Tennis Courts</b>									
Courts resurface	2	Each	8	0	\$4,500.00	\$9,000.00	\$11,401.00	\$1,125.00	\$9,000.00
Windscreen	1,920	Square Feet	8	0	\$1.20	\$2,304.00	\$2,919.00	\$288.00	\$2,304.00
<i>Subtotal:</i>						\$11,304.00	\$14,320.00	\$1,413.00	\$11,304.00
<b>Totals:</b>						<b>\$1,399,887.46</b>	<b>\$2,207,532.00</b>	<b>\$93,347.83</b>	<b>\$811,933.88</b>



## Component Replacement Cost Chart (by category)

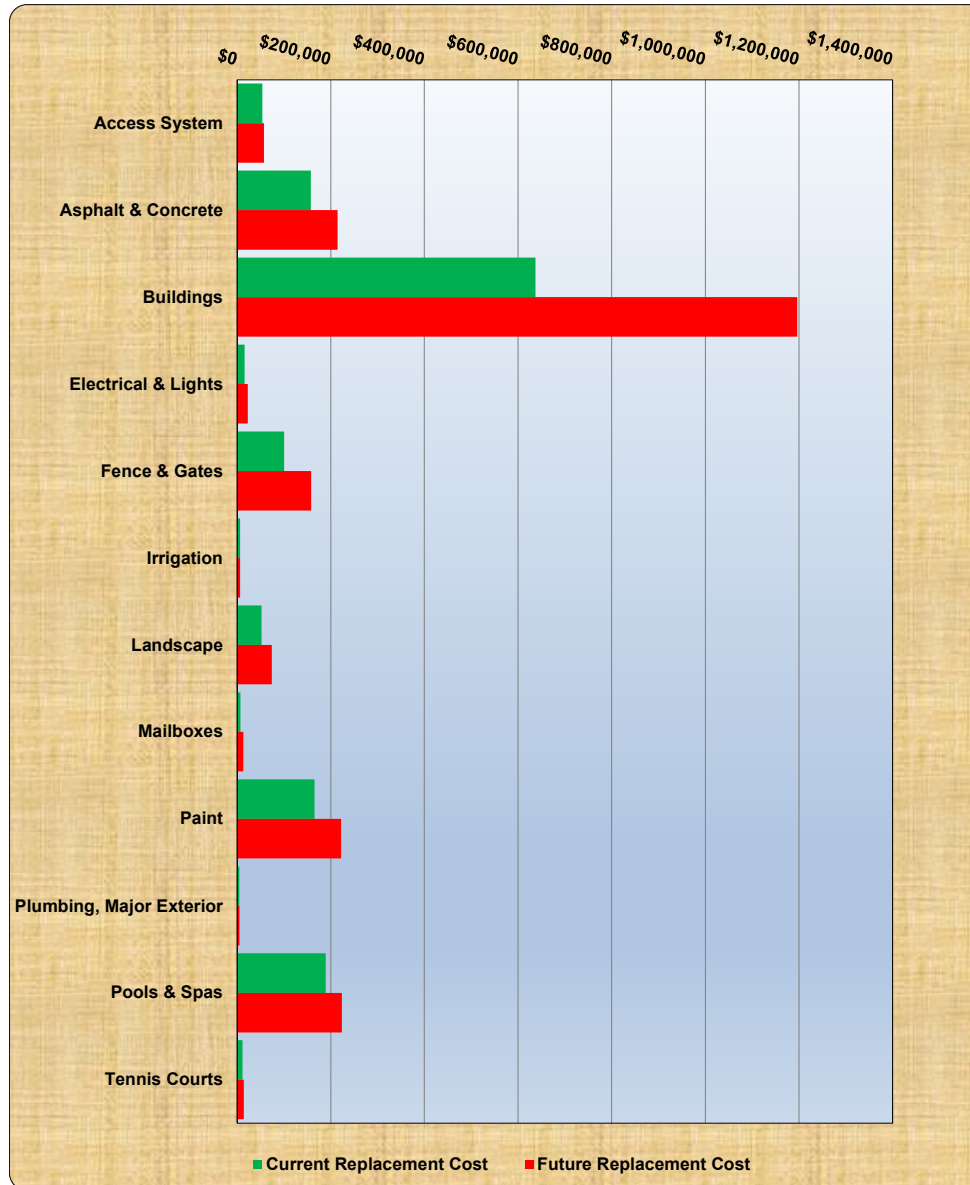

## Cash Flow and Percent Funded Projections


*Fiscal Year: July 1, 2022 through June 30, 2023*

Year	End of Year				Revenue					Expenditures		
	100% Funded	Cash Flow	Percent Funded	Cash Flow (w/o Funding Plan)	Contribution Annual	Contribution Unit/Month	Funding Plan	Reserve Reimbursement	Interest	Components	Deferred & Non-Recurring	Taxes
2022	\$811,934	\$323,500	39.84%	\$323,500								
2023	\$650,474	\$154,780	23.79%	\$140,645	\$70,800.00	\$98.33		\$14,000	\$1,287	\$254,807	\$0	\$0
2024	\$670,411	\$161,558	24.10%	\$136,608	\$81,420.00	\$113.08	15.00%	\$0	\$1,233	\$75,875	\$0	\$0
2025	\$725,364	\$215,579	29.72%	\$167,432	\$93,633.00	\$130.05	15.00%	\$0	\$1,695	\$41,306	\$0	\$0
2026	\$771,907	\$273,195	35.39%	\$187,501	\$107,677.95	\$149.55	15.00%	\$0	\$2,203	\$52,265	\$0	\$0
2027	\$829,690	\$357,965	43.14%	\$218,114	\$123,829.64	\$171.99	15.00%	\$0	\$2,961	\$42,021	\$0	\$0
2028	\$841,931	\$392,086	46.57%	\$191,934	\$129,401.98	\$179.72	4.50%	\$0	\$3,296	\$98,577	\$0	\$0
2029	\$851,758	\$423,220	49.69%	\$158,261	\$133,284.04	\$185.12	3.00%	\$0	\$3,589	\$105,739	\$0	\$0
2030	\$939,235	\$550,462	58.61%	\$216,025	\$137,282.56	\$190.67	3.00%	\$0	\$4,797	\$14,838	\$0	\$0
2031	\$985,588	\$633,272	64.25%	\$224,521	\$141,401.03	\$196.39	3.00%	\$0	\$5,621	\$64,211	\$0	\$0
2032	\$923,060	\$566,705	61.39%	\$78,629	\$145,643.07	\$202.28	3.00%	\$0	\$5,001	\$217,212	\$0	\$0
2033	\$887,566	\$541,272	60.98%	(\$30,727)	\$150,012.36	\$208.35	3.00%	\$0	\$4,711	\$180,156	\$0	\$0
2034	\$782,309	\$401,550	51.33%	(\$257,510)	\$154,512.73	\$214.60	3.00%	\$0	\$3,348	\$297,583	\$0	\$0
2035	\$684,595	\$277,885	40.59%	(\$471,613)	\$159,148.11	\$221.04	3.00%	\$0	\$2,090	\$284,903	\$0	\$0
2036	\$774,159	\$402,179	51.95%	(\$443,643)	\$163,922.55	\$227.67	3.00%	\$0	\$3,201	\$42,830	\$0	\$0
2037	\$882,438	\$560,612	63.53%	(\$387,992)	\$168,840.23	\$234.50	3.00%	\$0	\$4,741	\$15,149	\$0	\$0
2038	\$845,891	\$517,703	61.20%	(\$538,381)	\$173,905.44	\$241.54	3.00%	\$0	\$4,375	\$221,189	\$0	\$0
2039	\$864,976	\$557,145	64.41%	(\$611,971)	\$179,122.60	\$248.78	3.00%	\$0	\$4,709	\$144,390	\$0	\$0
2040	\$971,572	\$716,265	73.72%	(\$572,765)	\$184,496.28	\$256.24	3.00%	\$0	\$6,218	\$31,594	\$0	\$0
2041	\$966,693	\$730,574	75.57%	(\$684,083)	\$190,031.17	\$263.93	3.00%	\$0	\$6,396	\$182,118	\$0	\$0
2042	\$939,118	\$710,926	75.70%	(\$834,851)	\$195,732.10	\$271.85	3.00%	\$0	\$6,188	\$221,568	\$0	\$0
2043	\$950,846	\$766,045	80.56%	(\$917,215)	\$201,604.07	\$280.01	3.00%	\$0	\$6,679	\$153,164	\$0	\$0
2044	\$1,028,351	\$883,284	85.89%	(\$944,620)	\$207,652.19	\$288.41	3.00%	\$0	\$7,792	\$98,205	\$0	\$0
2045	\$1,133,964	\$1,050,594	92.65%	(\$929,799)	\$213,881.75	\$297.06	3.00%	\$0	\$9,407	\$55,979	\$0	\$0
2046	\$1,273,371	\$1,272,060	99.90%	(\$869,390)	\$220,298.21	\$305.97	3.00%	\$0	\$11,559	\$10,391	\$0	\$0
2047	\$1,122,561	\$1,106,744	98.59%	(\$1,200,858)	\$226,907.15	\$315.15	3.00%	\$0	\$10,045	\$402,268	\$0	\$0
2048	\$972,845	\$795,024	81.72%	(\$1,682,466)	\$233,714.37	\$324.60	3.00%	\$0	\$6,973	\$552,408	\$0	\$0
2049	\$1,041,038	\$887,010	85.20%	(\$1,768,094)	\$240,725.80	\$334.34	3.00%	\$0	\$7,688	\$156,428	\$0	\$0
2050	\$1,152,811	\$1,067,055	92.56%	(\$1,774,606)	\$247,947.57	\$344.37	3.00%	\$0	\$9,410	\$77,312	\$0	\$0
2051	\$1,239,536	\$1,221,635	98.56%	(\$1,815,537)	\$255,386.00	\$354.70	3.00%	\$0	\$10,925	\$111,731	\$0	\$0
2052	\$1,222,979	\$1,228,665	100.46%	(\$2,011,776)	\$263,047.58	\$365.34	3.00%	\$0	\$11,021	\$267,039	\$0	\$0
<b>Totals:</b>					<b>\$5,195,261.51</b>			<b>\$14,000</b>	<b>\$169,160</b>	<b>\$4,473,257</b>	<b>\$0</b>	<b>\$0</b>



## Cash Flow and Percent Funded Chart

(June 30, 2023)

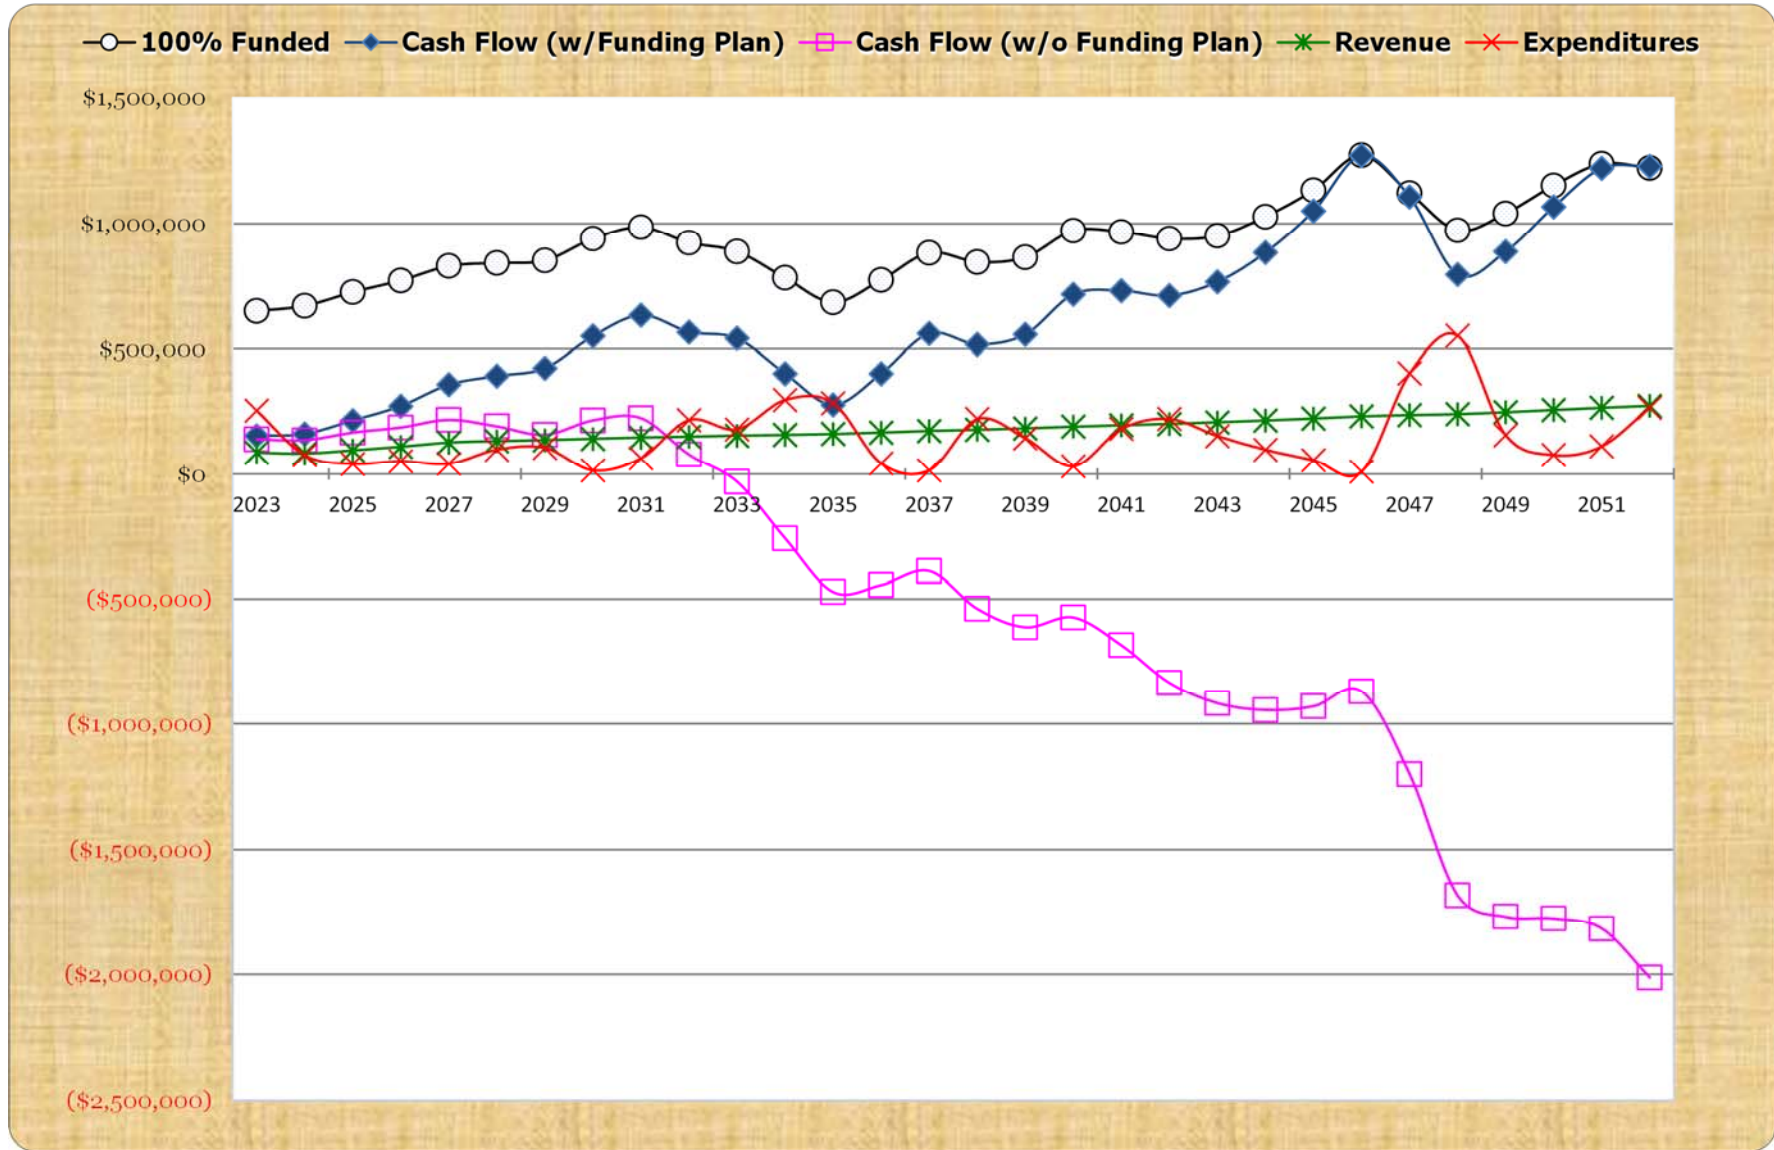



## 10 Year Expenditure and Cash Flow by Category

	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032
<b>Beginning Balance</b>	\$323,500	\$154,780	\$161,558	\$215,579	\$273,195	\$357,965	\$392,086	\$423,220	\$550,462	\$633,272
<b>Contribution</b>	\$70,800	\$81,420	\$93,633	\$107,678	\$123,830	\$129,402	\$133,284	\$137,283	\$141,401	\$145,643
<i>Average/Month/Unit</i>	<i>\$98.33</i>	<i>\$113.08</i>	<i>\$130.05</i>	<i>\$149.55</i>	<i>\$171.99</i>	<i>\$179.73</i>	<i>\$185.12</i>	<i>\$190.67</i>	<i>\$196.39</i>	<i>\$202.28</i>
<i>Percent Change</i>	<i>0.00%</i>	<i>15.00%</i>	<i>15.00%</i>	<i>15.00%</i>	<i>15.00%</i>	<i>4.50%</i>	<i>3.00%</i>	<i>3.00%</i>	<i>3.00%</i>	<i>3.00%</i>
<b>Reserve Reimbursement</b>	\$14,000	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
<b>Interest Earned</b>	\$1,287	\$1,233	\$1,695	\$2,203	\$2,961	\$3,296	\$3,589	\$4,797	\$5,621	\$5,001
<b>Tax on Interest</b>	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Net Interest	\$1,287	\$1,233	\$1,695	\$2,203	\$2,961	\$3,296	\$3,589	\$4,797	\$5,621	\$5,001
<b>Access System</b>										
Gate operators		\$8,652	\$8,912							
Loop systems		\$7,210	\$7,426							
Phone directory		\$4,841								
Surveillance system				\$20,215						
<b>Asphalt &amp; Concrete</b>										
Concrete, curb/gutter repair	\$2,500				\$2,814				\$3,167	
Concrete, stamped, color seal	\$8,514					\$9,870				
Concrete, stamped, Entries										\$59,247
Concrete, walkways	\$5,000			\$5,464			\$5,970			\$6,524
Repair/overlay/R&R	\$7,500			\$8,195						
Seal/stripe/repair/crack fill	\$6,000				\$6,753				\$7,601	
<b>Buildings</b>										
Awnings, canvas (allowance)	\$1,065	\$1,097	\$1,130	\$1,164	\$1,199	\$1,235	\$1,272	\$1,310	\$1,349	\$1,390
Landings/stairs, coating	\$22,004					\$25,509				
Landings/stairs, inspection (SB361/ \$5551)										
Roofs, carports, tile/underlayment										
Roofs, flat, elastomeric coating										\$130,480
Roofs, flat, polyurethane foam										
Roofs, tile/underlayment										
Windows, replace (on decks)		\$6,566		\$6,966		\$7,883		\$8,363		\$8,872
<b>Electrical &amp; Lights</b>										
Fixtures, globe/pole 6'										



## Expenditure and Cash Flow Report

(continued)

	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032
Fixtures, wall mount										
Fixtures/poles, Tennis Courts										
Landscape fixtures, repairs/ replacement	\$2,200	\$2,266	\$2,334	\$2,404	\$2,476	\$2,550	\$2,627	\$2,706	\$2,787	\$2,871
<b>Fence &amp; Gates</b>										
Fence, metal, perimeter										
Fence, metal, pool areas										
Gates, metal, vehicle										
<b>Irrigation</b>										
Controllers		\$6,592								
<b>Landscape</b>										
Fountain, replace	\$2,000									
Landscape, refurbish										
Storage shed										
<b>Mailboxes</b>										
Mailboxes										
<b>Paint</b>										
Buildings, doors (sand/stain)	\$36,000						\$42,986			
Buildings, stucco (~72500 SF)	\$66,000									
Carports, stucco	\$30,043									
Fence, chainlink, Tennis Courts	\$7,000									
Fence, metal, perimeter	\$12,960				\$14,587				\$16,417	
Fence, metal, Pool Areas	\$2,960				\$3,332				\$3,750	
Mailboxes & trash gates	\$900				\$1,013				\$1,140	
Walls, stucco	\$9,207									
<b>Plumbing, Major Exterior</b>										
Sewer pipe repairs	\$4,750		\$5,039		\$5,346		\$5,672		\$6,017	
<b>Pools &amp; Spas</b>										
East, deck coating	\$8,150					\$9,448				
East, deck resurface										
East, deck skimmers			\$6,790							
East, furniture		\$6,180								\$7,829



## Expenditure and Cash Flow Report

(continued)

	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032
East, pool filter		\$1,339					\$1,552			
East, pool heater									\$5,067	
East, pool pumpsets, VS						\$4,637				
East, pool resurface							\$18,776			
East, pool solar panels		\$7,854								
East, pool tile										
East, spa filter		\$1,339								
East, spa heater		\$4,120								
East, spa pumpset, circulation, VS							\$2,388			
East, spa pumpsets, jet									\$2,597	
East, spa resurface			\$4,583							
East, spa tile		\$824								
West, deck coating	\$8,750					\$10,144				
West, deck resurface						\$20,287				
West, deck skimmers			\$5,092							
West, furniture					\$4,502					
West, pool filters				\$2,841						
West, pool heater		\$4,120								
West, pool pumpsets, VS						\$4,637				
West, pool resurface							\$18,168			
West, pool solar panels		\$12,875								
West, pool tile										
West, spa filter							\$1,552			
West, spa heater							\$4,776			
West, spa pumpset, circulation, VS								\$2,460		
West, spa pumpsets, jet						\$2,377				
West, spa resurface				\$5,016						
West, spa tile										
<b>Tennis Courts</b>										
Courts resurface	\$9,000								\$11,401	
Windscreen	\$2,304								\$2,919	



## Expenditure and Cash Flow Report

(continued)

	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032
<b>Component Exp</b>	\$254,807	\$75,875	\$41,306	\$52,265	\$42,021	\$98,577	\$105,739	\$14,838	\$64,211	\$217,212
<b>Non-recurring Exp</b>	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
<b>Ending Balance</b>	<b>\$154,780</b>	<b>\$161,558</b>	<b>\$215,579</b>	<b>\$273,195</b>	<b>\$357,965</b>	<b>\$392,086</b>	<b>\$423,220</b>	<b>\$550,462</b>	<b>\$633,272</b>	<b>\$566,705</b>





## Professional Credentials

*Michael C. Graves R.S.*  
*Reserve Funding Specialist*

### Designations

- ◆ Reserve Specialist (RS), 2000,  
Community Association Institute

### Distinctions

- ◆ Educated Business Partner (EBP), 2013,  
Community Association Institute

### Degrees

- ◆ B.A., Economics, 1983,  
San Diego State University
- ◆ A.S., Business Administration, 1980,  
Citrus College

### Associations

- ◆ California Association of Community Managers  
(CACM):

*Past Instructor for Facilities Management  
Course VIII, "The Guide to Reserve Study  
Components & Funding",*

*Past Ambassador Committee Member*

- ◆ Community Associations Institute (CAI),  
Affiliate Member:
  - Coachella Valley Chapter (CV)
  - Greater Inland Empire Chapter (GRIE)
    - *Past President,*
  - Orange County Regional Chapter (OCRC)
    - *Past Board Treasurer*
  - San Diego Chapter (SD)
    - *Past Board Treasurer*

### Publications

- ◆ "Ask The Experts", O.C. View, May/June 2004.
- ◆ "Fiduciary Responsibility Forum",  
CondoManagement, December 2003.
- ◆ "Does Our Association Have Money Or Not",  
Quorum, June 2001.
- ◆ "How Do You Use Your Reserve Study To  
Finance Remodeling Work", Quorum, April  
2000.
- ◆ Numerous Speaking and Panel Engagements

### Awards

- ◆ Community Associations Institute, GRIE,  
2012 Hall of Fame  
2000 *Committee Member of the Year*
- ◆ Community Associations Institute, OCRC,  
2009 Committee Member of the Year  
2006 *Ellen Elish Award*  
2006 *Presidents Award*
- ◆ California Association of Community Managers,  
2001, Vision Award, *Excellence in Service*

### Professional Responsibilities

As Reserve Fund Specialist for SCT Reserve  
Consultants, Inc. Mr. Graves:

- ◆ Manages reserve study site inspections and  
funding analyses
- ◆ Prepares reserve study reports and proposals
- ◆ Markets reserve study services through  
professional contacts and trade associations'  
meetings and shows

### Professional Experience

Mr. Graves' reserve study experience includes:

- ◆ Numerous Levels I, II, and III reserve studies  
throughout San Diego, Los Angeles, Orange,  
Riverside, San Bernardino, and Imperial  
Counties.
- ◆ Familiar with components that go into a reserve  
study.
- ◆ Able to assist Associations in determining a  
well-suited funding plan that fits their reserve  
goals.
- ◆ Utilizing Property Reserve Analysis (PRA)  
System software to generate Component  
definition files.
- ◆ Developing SCT Reserve Analysis System  
software to calculate elements used in the Rough  
Draft and Final Reports.
- ◆ Meet with Association's Board of Directors to  
review the draft of the reserve study.
- ◆ Consideration of Board's input with respect to  
incorporate component replacement and funding  
policies.



## Disclosure Statements

SCT Reserve Consultants, Inc. endeavors to provide the most accurate reserve study possible. However, the current replacement costs of the listed components are based on estimates utilizing local trades, contractor interviews, and national cost databases. Regular maintenance of reserve components is required to realize the full useful life of each component. Changes in fees for labor and materials, acts of God, extraordinary weather conditions, vandalism and unusual wear of the reserve components may have an adverse impact on the useful life and the cost to replace a particular reserve component. SCT Reserve Consultants, Inc. did not identify, nor did it purport to expound on, any possible construction defects on the project. All dollar figures are subject to rounding errors.

The completeness of this reserve study relies heavily on information provided to us by the Association's representative(s). Incomplete or missing information may cause a distortion of the Association's financial condition. The reserve balance presented in this reserve study is based on information provided and was not audited. SCT Reserve Consultants, Inc. assumes that the information provided to us by the Association's representative(s) is both reliable and accurate and for a Level II study (update with-site-visit) and Level III study (update with no-site-visit) the Association is to have considered previously developed component quantities and/or lump sum expenditures as accurate and reliable. Information provided about reserve projects is also understood to be reliable. Any on-site inspection should not be considered a project audit or quality inspection.

In the event we have performed an on-site inspection of the community, the data compiled has been used with financial, physical, quantity, and historical information provided by the Association's representative(s). Our physical inspection would consist primarily of visual inspection, measurement, drawing take-offs, and photographic documentation. No destructive testing methods were used.

SCT Reserve Consultants, Inc. has prepared this reserve study in conformance with the requirements laid out by the California Civil Code (§5550) and the Community Association Institute (CAI). We have no other current involvement with CANYON GRANADA HOMEOWNERS ASSOCIATION and have no actual or perceived conflicts of interest with CANYON GRANADA HOMEOWNERS ASSOCIATION.

This reserve study is a reflection of the information provided to us by the Association's representative(s) and is assembled for the budgeting and planning purposes of the Board of Directors only. Information provided about reserve projects will be considered reliable. The reserve study is not to be used for the purpose of performing an audit, quality/forensic analyses, or background checks of historical records.



## Definition of Terms

**100% Funded** – from the “Component Identification Report”, see Fully Funded Balance (FFB).

**Basis Cost** - the estimated unit (of measurement basis) replacement cost.

**Cash Flow Method** - a method of developing a reserve funding plan where contributions to the reserve fund are designed to offset the variable annual expenditures from the reserve fund. Different reserve funding plans are tested against the anticipated schedule of reserve expenses until the desired funding goal is achieved.

**Contingency Fund** – typically 3.0% to 5.0% of annual reserve allocation may be established to pay for incidental and miscellaneous reserve expenditures (optional).

**Current Replacement Cost (estimated)** - the total estimated cost of a component’s replacement or long-term maintenance action at the time of the study. This amount is calculated by multiplying the measurement basis quantity times the basis cost.

**Davis-Stirling Common Interest Development Act** - the name for the sections of the California Civil Code (4000 through 6150) that are the framework for the operation and management of common interest developments in California.

**Fully Funded Balance (FFB)** - total accrued depreciation. This number is calculated for each reserve component, then summed together for a total dollar value.

Expressed as  $FFB = (Estimated\ Used\ Life) / (Estimated\ Full\ Life) \times (Current\ Replacement\ Cost)$

**FUL Full Useful Life (estimated)** - the original estimate of a period of time that a component will last before major long-term maintenance or replacement is required.

**Funding Goals** – there are four basic categories of funding plan goals:

- ⇒ **Baseline Funding** – establishing a reserve-funding goal of keeping the reserve cash balance above zero.
- ⇒ **Full Funding** – setting a reserve-funding goal of attaining and maintaining reserves at or near 100% funded.
- ⇒ **Statutory Funding** – establishing a reserve-funding goal of setting aside the specific minimum amount of reserves required by local statutes.
- ⇒ **Threshold Funding** – establishing a reserve-funding goal of keeping the reserve balance above a specified dollar or percent funded amount.

**Funding Plan** – this is the year-by-year percentage increase to the reserve allocation.

**Future Replacement Cost (estimated)** – the current replacement cost multiplied by an inflation factor (compounded annually).

**Level I Reserve Study** - is considered a full study, it consists of:

- ⇒ **Component Inventory** - quantification and verification of the reserve components.
- ⇒ **Condition Assessment** – the task of evaluating the current condition of the component based on observed or reported conditions.
- ⇒ **Life and Valuation Estimates** – the task of estimating Full Life, Remaining Life and repair and replacement costs for the components.
- ⇒ **Fund Status** – status of the reserve fund as compared to an established benchmark such as percent funding.
- ⇒ **Funding Plan** – an Association’s plan to provide income to the reserve fund to offset anticipated expenditures from that fund.

**Level II Reserve Study** - is considered an update (on-site) study, it consists of:

- ⇒ **Component Inventory** - verification of the reserve components only, no quantification.
- ⇒ **Condition Assessment** – the task of evaluating the current condition of the component based on observed or reported conditions.
- ⇒ **Life and Valuation Estimates** – the task of estimating Full Life, Remaining Life and repair and replacement costs for the components.



## Definition of Terms (continued)

- ⇒ **Fund Status** – status of the reserve fund as compared to an established benchmark such as percent funding.
- ⇒ **Funding Plan** – an Association’s plan to provide income to the reserve fund to offset anticipated expenditures from that fund.

**Level III Reserve Study** - is considered a financial update, it consists of:

- ⇒ **Life and Valuation Estimates** – the task of estimating Full Life, Remaining Life and repair and replacement costs for the components.
- ⇒ **Fund Status** – status of the reserve fund as compared to an established benchmark such as percent funding.
- ⇒ **Funding Plan** – an Association’s plan to provide income to the reserve fund to offset anticipated expenditures from that fund.

**Measurement Basis** - the unit of measurement, i.e.: each, linear feet, square feet, squares (100 sf).

**Percent Funded** – the ratio, at a particular point of time, of the actual (or projected) Reserve Balance to the Fully Funded Balance, expressed as a percentage.

**RUL Remaining Useful Life (estimated)** - an educated evaluation of the amount of time before the component will need replacement.

**Reserve Allocation** - money that is collected and applied to particular components (see Year 2023 Reserve Budget).

**Reserve Component** - is defined as any major component that needs major maintenance or replacement at a frequency exceeding two years but typically not more than 30 years.

**Reserve Fund Balance (estimated)** - the estimated amount of money in the reserve account(s) as of the study date, typically calculated by adding the prior year’s current reserve balance, remaining reserve allocations, and interest, and then subtracting any known reserve expenditures through the same prior year.

**Reserve Study** - is a budget-planning tool that identifies the current status of the reserve fund and offers a stable and equitable funding plan to offset the anticipated future major common area expenditures. It consists of two parts:

- ⇒ **Financial Analysis** - the portion of the reserve study where the current status of the reserves (Fund Status) are measured as cash or percent funded and a recommended reserve contribution rate (Funding Plan) are derived, and the projected reserve income and expense over time is presented.
- ⇒ **Physical Analysis** - the portion of the reserve study where the Component Inventory, Condition Assessment, and Life and Valuation Estimate tasks are performed.

**Straight Line Allocation (Annual)** – from the “Component Identification Report” is a single year’s 100% funded amount, often referred to as the ideal or recommended allocation level.

$$\text{Expressed as } \text{SLA} = (I) / (\text{Estimated Full Life}) \times (\text{Current Replacement Cost})$$

**Weighted Average Life (WAL)** - is calculated by multiplying the cost of each component by the number of months until replacement, creating a weighted average life factor. The total of the factors is divided by the total replacement cost, producing the WAL.





## 2020 California Civil Code (Selected Sections)

### PART 5. COMMON INTEREST DEVELOPMENTS

#### CHAPTER 6. ASSOCIATION GOVERNANCE

##### ARTICLE 7. ANNUAL REPORTS

###### §5300. Annual Budget, Reserves and Other Required Disclosures

(a) Notwithstanding a contrary provision in the governing documents, an association shall distribute an annual budget report 30 to 90 days before the end of its fiscal year.

(b) Unless the governing documents impose more stringent standards, the annual budget report shall include all of the following information:

(1) A pro forma operating budget, showing the estimated revenue and expenses on an accrual basis.

(2) A summary of the association's reserves, prepared pursuant to Section 5565.

(3) A summary of the reserve funding plan adopted by the board, as specified in paragraph (5) of subdivision (b) of Section 5550. The summary shall include notice to members that the full reserve study plan is available upon request, and the association shall provide the full reserve plan to any member upon request.

(4) A statement as to whether the board has determined to defer or not undertake repairs or replacement of any major component with a remaining life of 30 years or less, including a justification for the deferral or decision not to undertake the repairs or replacement.

(5) A statement as to whether the board, consistent with the reserve funding plan adopted pursuant to Section 5560, has determined or anticipates that the levy of one or more special assessments will be required to repair, replace, or restore any major component or to provide adequate reserves therefor. If so, the statement shall also set out the estimated amount, commencement date, and duration of the assessment.

(6) A statement as to the mechanism or mechanisms by which the board will fund reserves to repair or replace major components, including assessments, borrowing, use of other assets, deferral of selected replacements or repairs, or alternative mechanisms.

(7) A general statement addressing the procedures used for the calculation and establishment of those reserves to defray the future repair, replacement, or additions to those major components that the association is obligated to maintain. The statement shall include, but need not be limited to, reserve calculations made using the formula described in paragraph (4) of subdivision (b) of Section 5570, and may not assume a rate of return on cash reserves in excess of 2 percent above the discount rate published by the Federal Reserve Bank of San Francisco at the time the calculation was made.

(8) A statement as to whether the association has any outstanding loans with an original term of more than one year, including the payee, interest rate, amount outstanding, annual payment, and when the loan is scheduled to be retired.

(9) A summary of the association's property, general liability, earthquake, flood, and fidelity insurance policies. For each policy, the summary shall include the name of the insurer, the type of insurance, the policy limit, and the amount of the deductible, if any. To the extent that any of the required information is specified in the insurance policy declaration page, the association may meet its obligation to disclose that information by making copies of that page and distributing it with the annual budget report. The summary distributed pursuant to this paragraph shall contain, in at least 10-point boldface type, the following statement:

"This summary of the association's policies of insurance provides only certain information, as required by Section 5300 of the Civil Code, and should not be considered a substitute for the complete policy terms and conditions contained in the actual policies of insurance. Any association member may, upon request and provision of reasonable notice, review the association's insurance policies and, upon request and payment of reasonable duplication charges, obtain copies of those policies. Although the association maintains the policies of insurance specified in this summary, the association's policies of insurance may not cover your property, including personal property or real property improvements to or around your dwelling, or personal injuries or other losses that occur within or around your dwelling. Even if a loss is covered, you may nevertheless be responsible for paying all or a portion of any deductible that applies. Association members should consult with their individual insurance broker or agent for appropriate additional coverage."



## 2020 California Civil Code (Selected Sections) (continued)

(10) When the common interest development is a condominium project, a statement describing the status of the common interest development as a Federal Housing Administration (FHA)-approved condominium project pursuant to FHA guidelines, including whether the common interest development is an FHA-approved condominium project. The statement shall be in at least 10-point font on a separate piece of paper and in the following form:

“Certification by the Federal Housing Administration may provide benefits to members of an association, including an improvement in an owner’s ability to refinance a mortgage or obtain secondary financing and an increase in the pool of potential buyers of the separate interest.

This common interest development [is/is not (circle one)] a condominium project. The association of this common interest development [is/is not (circle one)] certified by the Federal Housing Administration.”

(11) When the common interest development is a condominium project, a statement describing the status of the common interest development as a federal Department of Veterans Affairs (VA)-approved condominium project pursuant to VA guidelines, including whether the common interest development is a VA-approved condominium project. The statement shall be in at least 10-point font on a separate piece of paper and in the following form:

“Certification by the federal Department of Veterans Affairs may provide benefits to members of an association, including an improvement in an owner’s ability to refinance a mortgage or obtain secondary financing and an increase in the pool of potential buyers of the separate interest.

This common interest development [is/is not (circle one)] a condominium project. The association of this common interest development [is/is not (circle one)] certified by the federal Department of Veterans Affairs.”

(12) A copy of the completed “Charges For Documents Provided” disclosure identified in Section 4528. For purposes of this section, “completed” means that the “Fee for Document” section of the form individually identifies the costs associated with providing each document listed on the form.

(c) The annual budget report shall be made available to the members pursuant to Section 5320.

(d) The summary of the association’s reserves disclosed pursuant to paragraph (2) of subdivision (b) shall not be admissible in evidence to show improper financial management of an association, provided that other relevant and competent evidence of the financial condition of the association is not made inadmissible by this provision.

(e) The Assessment and Reserve Funding Disclosure Summary form, prepared pursuant to Section 5570, shall accompany each annual budget report or summary of the annual budget report that is delivered pursuant to this article. [2017 - Based on former §§ 1365 & 1365.2.5(b)(2)]

## CHAPTER 7. FINANCES

### ARTICLE 1. ACCOUNTING

#### §5500. Board’s Duty to Review Financial Statements and Accounts

Unless the governing documents impose more stringent standards, the board shall do all of the following:

(a) Review, on a monthly basis, a current reconciliation of the association’s operating accounts.

(b) Review, on a monthly basis, a current reconciliation of the association’s reserve accounts.

(c) Review, on a monthly basis, the current year’s actual operating revenues and expenses compared to the current year’s budget.

(d) Review, on a monthly basis, the latest account statements prepared by the financial institutions where the association has its operating and reserve accounts.

(e) Review, on a monthly basis, an income and expense statement for the association’s operating and reserve accounts.

(f) Review, on a monthly basis, the check register, monthly general ledger, and delinquent assessment receivable reports. [2018 - Based on former §1365.5(a)]

#### §5501. Review of Financial Statements and Accounts



## 2020 California Civil Code (Selected Sections) (continued)

The review requirements of Section 5500 may be met when every individual member of the board, or a subcommittee of the board consisting of the treasurer and at least one other board member, reviews the documents and statements described in Section 5500 independent of a board meeting, so long as the review is ratified at the board meeting subsequent to the review and that ratification is reflected in the minutes of that meeting. [2018]

### **§5502. Account Deposits and Transfers**

Notwithstanding any other law, transfers of greater than ten thousand dollars (\$10,000) or 5 percent of an association's total combined reserve and operating account deposits, whichever is lower, shall not be authorized from the association's reserve or operating accounts without prior written board approval. This section applies in addition to any other applicable requirements of this part. [2019]

## **ARTICLE 2. USE OF RESERVE FUNDS**

### **§5510. Signatures on and Limitation on Use of Reserve Funds**

(a) The signatures of at least two persons, who shall be directors, or one officer who is not a director and one who is a director, shall be required for the withdrawal of moneys from the association's reserve accounts.

(b) The board shall not expend funds designated as reserve funds for any purpose other than the repair, restoration, replacement, or maintenance of, or litigation involving the repair, restoration, replacement, or maintenance of, major components that the association is obligated to repair, restore, replace, or maintain and for which the reserve fund was established. [2012 - Based on former §1365.5(b & (c)(1)]

### **§5515. Transfer or Borrowing from Reserve Funds**

(a) Notwithstanding Section 5510, the board may authorize the temporary transfer of moneys from a reserve fund to the association's general operating fund to meet short-term cashflow requirements or other expenses, if the board has provided notice of the intent to consider the transfer in a board meeting notice provided pursuant to Section 4920.

(b) The notice shall include the reasons the transfer is needed, some of the options for repayment, and whether a special assessment may be considered.

(c) If the board authorizes the transfer, the board shall issue a written finding, recorded in the board's minutes, explaining the reasons that the transfer is needed, and describing when and how the moneys will be repaid to the reserve fund.

(d) The transferred funds shall be restored to the reserve fund within one year of the date of the initial transfer, except that the board may, after giving the same notice required for considering a transfer, and, upon making a finding supported by documentation that a temporary delay would be in the best interests of the common interest development, temporarily delay the restoration.

(e) The board shall exercise prudent fiscal management in maintaining the integrity of the reserve account, and shall, if necessary, levy a special assessment to recover the full amount of the expended funds within the time limits required by this section. This special assessment is subject to the limitation imposed by Section 5605. The board may, at its discretion, extend the date the payment on the special assessment is due. Any extension shall not prevent the board from pursuing any legal remedy to enforce the collection of an unpaid special assessment. [2012 - Based on former §1365.5(c)(2)]

### **§5520. Using Reserve Funds for Litigation; Notice; Accounting**

(a) When the decision is made to use reserve funds or to temporarily transfer moneys from the reserve fund to pay for litigation pursuant to subdivision (b) of Section 5510, the association shall provide general notice pursuant to Section 4045 of that decision, and of the availability of an accounting of those expenses.

(b) Unless the governing documents impose more stringent standards, the association shall make an accounting of expenses related to the litigation on at least a quarterly basis. The accounting shall be made available for inspection by members of the association at the association's office. [2012- Based on former §1365.5(d)]



## 2020 California Civil Code (Selected Sections) (continued)

### ARTICLE 3. RESERVE PLANNING

#### **§5550. Reserve Study Inspection Frequency; Contents; Funding Plan**

- (a) At least once every three years, the board shall cause to be conducted a reasonably competent and diligent visual inspection of the accessible areas of the major components that the association is obligated to repair, replace, restore, or maintain as part of a study of the reserve account requirements of the common interest development, if the current replacement value of the major components is equal to or greater than one-half of the gross budget of the association, excluding the association's reserve account for that period. The board shall review this study, or cause it to be reviewed, annually and shall consider and implement necessary adjustments to the board's analysis of the reserve account requirements as a result of that review.
- (b) The study required by this section shall at a minimum include:
- (1) Identification of the major components that the association is obligated to repair, replace, restore, or maintain that, as of the date of the study, have a remaining useful life of less than 30 years.
  - (2) Identification of the probable remaining useful life of the components identified in paragraph (1) as of the date of the study.
  - (3) An estimate of the cost of repair, replacement, restoration, or maintenance of the components identified in paragraph (1).
  - (4) An estimate of the total annual contribution necessary to defray the cost to repair, replace, restore, or maintain the components identified in paragraph (1) during and at the end of their useful life, after subtracting total reserve funds as of the date of the study.
  - (5) A reserve funding plan that indicates how the association plans to fund the contribution identified in paragraph (4) to meet the association's obligation for the repair and replacement of all major components with an expected remaining life of 30 years or less, not including those components that the board has determined will not be replaced or repaired. [2012 - Based on former §1365.5(e)]

#### **§5551. Inspection of Elevated Elements (effective 1/1/2020)**

- (a) For purposes of this section, the following definitions apply:
- (1) "Associated waterproofing systems" include flashings, membranes, coatings, and sealants that protect the load-bearing components of exterior elevated elements from exposure to water.
  - (2) "Exterior elevated elements" mean the load-bearing components together with their associated waterproofing system.
  - (3) "Load-bearing components" means those components that extend beyond the exterior walls of the building to deliver structural loads to the building from decks, balconies, stairways, walkways, and their railings, that have a walking surface elevated more than six feet above ground level, that are designed for human occupancy or use, and that are supported in whole or in substantial part by wood or wood-based products.
  - (4) "Statistically significant sample" means a sufficient number of units inspected to provide 95 percent confidence that the results from the sample are reflective of the whole, with a margin of error of no greater than plus or minus 5 percent.
  - (5) "Visual inspection" means inspection through the least intrusive method necessary to inspect load-bearing components, including visual observation only or visual observation in conjunction with, for example, the use of moisture meters, borescopes, or infrared technology.
- (b)
- (1) At least once every nine years, the board of an association of a condominium project shall cause a reasonably competent and diligent visual inspection to be conducted by a licensed structural engineer or architect of a random and statistically significant sample of exterior elevated elements for which the association has maintenance or repair responsibility.
  - (2) The inspection shall determine whether the exterior elevated elements are in a generally safe condition and performing in accordance with applicable standards.



## 2020 California Civil Code (Selected Sections) (continued)

- (c) Prior to conducting the first visual inspection, the inspector shall generate a random list of the locations of each type of exterior elevated element. The list shall include all exterior elevated elements for which the association has maintenance or repair responsibility. The list shall be provided to the association for future use.
- (d) The inspector shall perform the visual inspections in accordance with the random list generated pursuant to subdivision (c). If during the visual inspection the inspector observes building conditions indicating that unintended water or water vapor has passed into the associated waterproofing system, thereby creating the potential for damage to the load-bearing components, then the inspector may conduct a further inspection. The inspector shall exercise their best professional judgment in determining the necessity, scope, and breadth of any further inspection.
- (e) Based upon the inspector's visual inspections, further inspection, and construction and materials expertise, the inspector shall issue a written report containing the following information:
- (1) The identification of the building components comprising the load-bearing components and associated waterproofing system.
  - (2) The current physical condition of the load-bearing components and associated waterproofing system, including whether the condition presents an immediate threat to the health and safety of the residents.
  - (3) The expected future performance and remaining useful life of the load-bearing components and associated waterproofing system.
  - (4) Recommendations for any necessary repair or replacement of the load-bearing components and associated waterproofing system.
- (f) The report issued pursuant to subdivision (e) shall be stamped or signed by the inspector, presented to the board, and incorporated into the study required by Section 5550.
- (g)
- (1) If, after inspection of any exterior elevated element, the inspector advises that the exterior elevated element poses an immediate threat to the safety of the occupants, the inspector shall provide a copy of the inspection report to the association immediately upon completion of the report, and to the local code enforcement agency within 15 days of completion of the report. Upon receiving the report, the association shall take preventive measures immediately, including preventing occupant access to the exterior elevated element until repairs have been inspected and approved by the local enforcement agency.
  - (2) Local enforcement agencies shall have the ability to recover enforcement costs associated with the requirements of this section from the association.
- (h) Each subsequent visual inspection conducted under this section shall commence with the next exterior elevated element identified on the random list and shall proceed in order through the list.
- (i) The first inspection shall be completed by January 1, 2025, and then every nine years thereafter in coordination with the reserve study inspection pursuant to Section 5550. All written reports shall be maintained for two inspection cycles as records of the association.
- (j)
- (1) The association shall be responsible for complying with the requirements of this section.
  - (2) The continued and ongoing maintenance and repair of the load-bearing components and associated waterproofing systems in a safe, functional, and sanitary condition shall be the responsibility of the association as required by the association's governing documents.
- (k) The inspection of buildings for which a building permit application has been submitted on or after January 1, 2020, shall occur no later than six years following the issuance of a certificate of occupancy. The inspection shall otherwise comply with the provisions of this section.
- (l) This section shall only apply to buildings containing three or more multifamily dwelling units.
- (m) The association board may enact rules or bylaws imposing requirements greater than those imposed by this section.
- (n) A local government or local enforcement agency may enact an ordinance or other rule imposing requirements greater than those imposed by this section. [2019]

### **§5560. Reserve Funding Plan Adoption; Assessments Needed for Adequate Funding**

- (a) The reserve funding plan required by Section 5550 shall include a schedule of the date and amount of any change in regular or special assessments that would be needed to sufficiently fund the reserve funding plan.



## 2020 California Civil Code (Selected Sections) (continued)

(b) The plan shall be adopted by the board at an open meeting before the membership of the association as described in Article 2 (commencing with Section 4900) of Chapter 6.

(c) If the board determines that an assessment increase is necessary to fund the reserve funding plan, any increase shall be approved in a separate action of the board that is consistent with the procedure described in Section 5605. [2012 - Based on former §1365.5(e)]

### **§5565. Contents of Association's Reserve Summary**

The summary of the association's reserves required by paragraph (2) of subdivision (b) of Section 5300 shall be based on the most recent review or study conducted pursuant to Section 5550, shall be based only on assets held in cash or cash equivalents, shall be printed in boldface type, and shall include all of the following:

(a) The current estimated replacement cost, estimated remaining life, and estimated useful life of each major component.

(b) As of the end of the fiscal year for which the study is prepared:

(1) The current estimate of the amount of cash reserves necessary to repair, replace, restore, or maintain the major components.

(2) The current amount of accumulated cash reserves actually set aside to repair, replace, restore, or maintain major components.

(3) If applicable, the amount of funds received from either a compensatory damage award or settlement to an association from any person for injuries to property, real or personal, arising out of any construction or design defects, and the expenditure or disposition of funds, including the amounts expended for the direct and indirect costs of repair of construction or design defects. These amounts shall be reported at the end of the fiscal year for which the study is prepared as separate line items under cash reserves pursuant to paragraph (2). Instead of complying with the requirements set forth in this paragraph, an association that is obligated to issue a review of its financial statement pursuant to Section 5305 may include in the review a statement containing all of the information required by this paragraph.

(c) The percentage that the amount determined for purposes of paragraph (2) of subdivision (b) equals the amount determined for purposes of paragraph (1) of subdivision (b).

(d) The current deficiency in reserve funding expressed on a per unit basis. The figure shall be calculated by subtracting the amount determined for purposes of paragraph (2) of subdivision (b) from the amount determined for purposes of paragraph (1) of subdivision (b) and then dividing the result by the number of separate interests within the association, except that if assessments vary by the size or type of ownership interest, then the association shall calculate the current deficiency in a manner that reflects the variation. [2012 - Based on former §1365(a)(2)]

### **§5570. Required Assessment and Reserve Funding Disclosure Summary**

(a) The disclosures required by this article with regard to an association or a property shall be summarized on the following form:

---

#### **ASSESSMENT AND RESERVE FUNDING DISCLOSURE SUMMARY FORM** *(typically pages 5 and 6, occasionally pages 6 and 7, of report)*

---

(b) For the purposes of preparing a summary pursuant to this section:

(1) "Estimated remaining useful life" means the time reasonably calculated to remain before a major component will require replacement.

(2) "Major component" has the meaning used in Section 5550. Components with an estimated remaining useful life of more than 30 years may be included in a study as a capital asset or disregarded from the reserve calculation, so long as the decision is revealed in the reserve study report and reported in the Assessment and Reserve Funding Disclosure Summary.



## 2020 California Civil Code (Selected Sections) (continued)

(3) The form set out in subdivision (a) shall accompany each annual budget report or summary thereof that is delivered pursuant to Section 5300. The form may be supplemented or modified to clarify the information delivered, so long as the minimum information set out in subdivision (a) is provided.

(4) For the purpose of the report and summary, the amount of reserves needed to be accumulated for a component at a given time shall be computed as the current cost of replacement or repair multiplied by the number of years the component has been in service divided by the useful life of the component. This shall not be construed to require the board to fund reserves in accordance with this calculation. [2016]

### **§5580. Community Service Association Disclosure Requirements**

(a) Unless the governing documents impose more stringent standards, any community service organization whose funding from the association or its members exceeds 10 percent of the organization's annual budget shall prepare and distribute to the association a report that meets the requirements of Section 5012 of the Corporations Code, and that describes in detail administrative costs and identifies the payees of those costs in a manner consistent with the provisions of Article 5 (commencing with Section 5200) of Chapter 6.

(b) If the community service organization does not comply with the standards, the report shall disclose the noncompliance in detail. If a community service organization is responsible for the maintenance of major components for which an association would otherwise be responsible, the community service organization shall supply to the association the information regarding those components that the association would use to complete disclosures and reserve reports required under this article and Section 5300. An association may rely upon information received from a community service organization and shall provide access to the information pursuant to the provisions of Article 5 (commencing with Section 5200) of Chapter 6. [2012 - Based on former §1365.3]

